


GROUP C

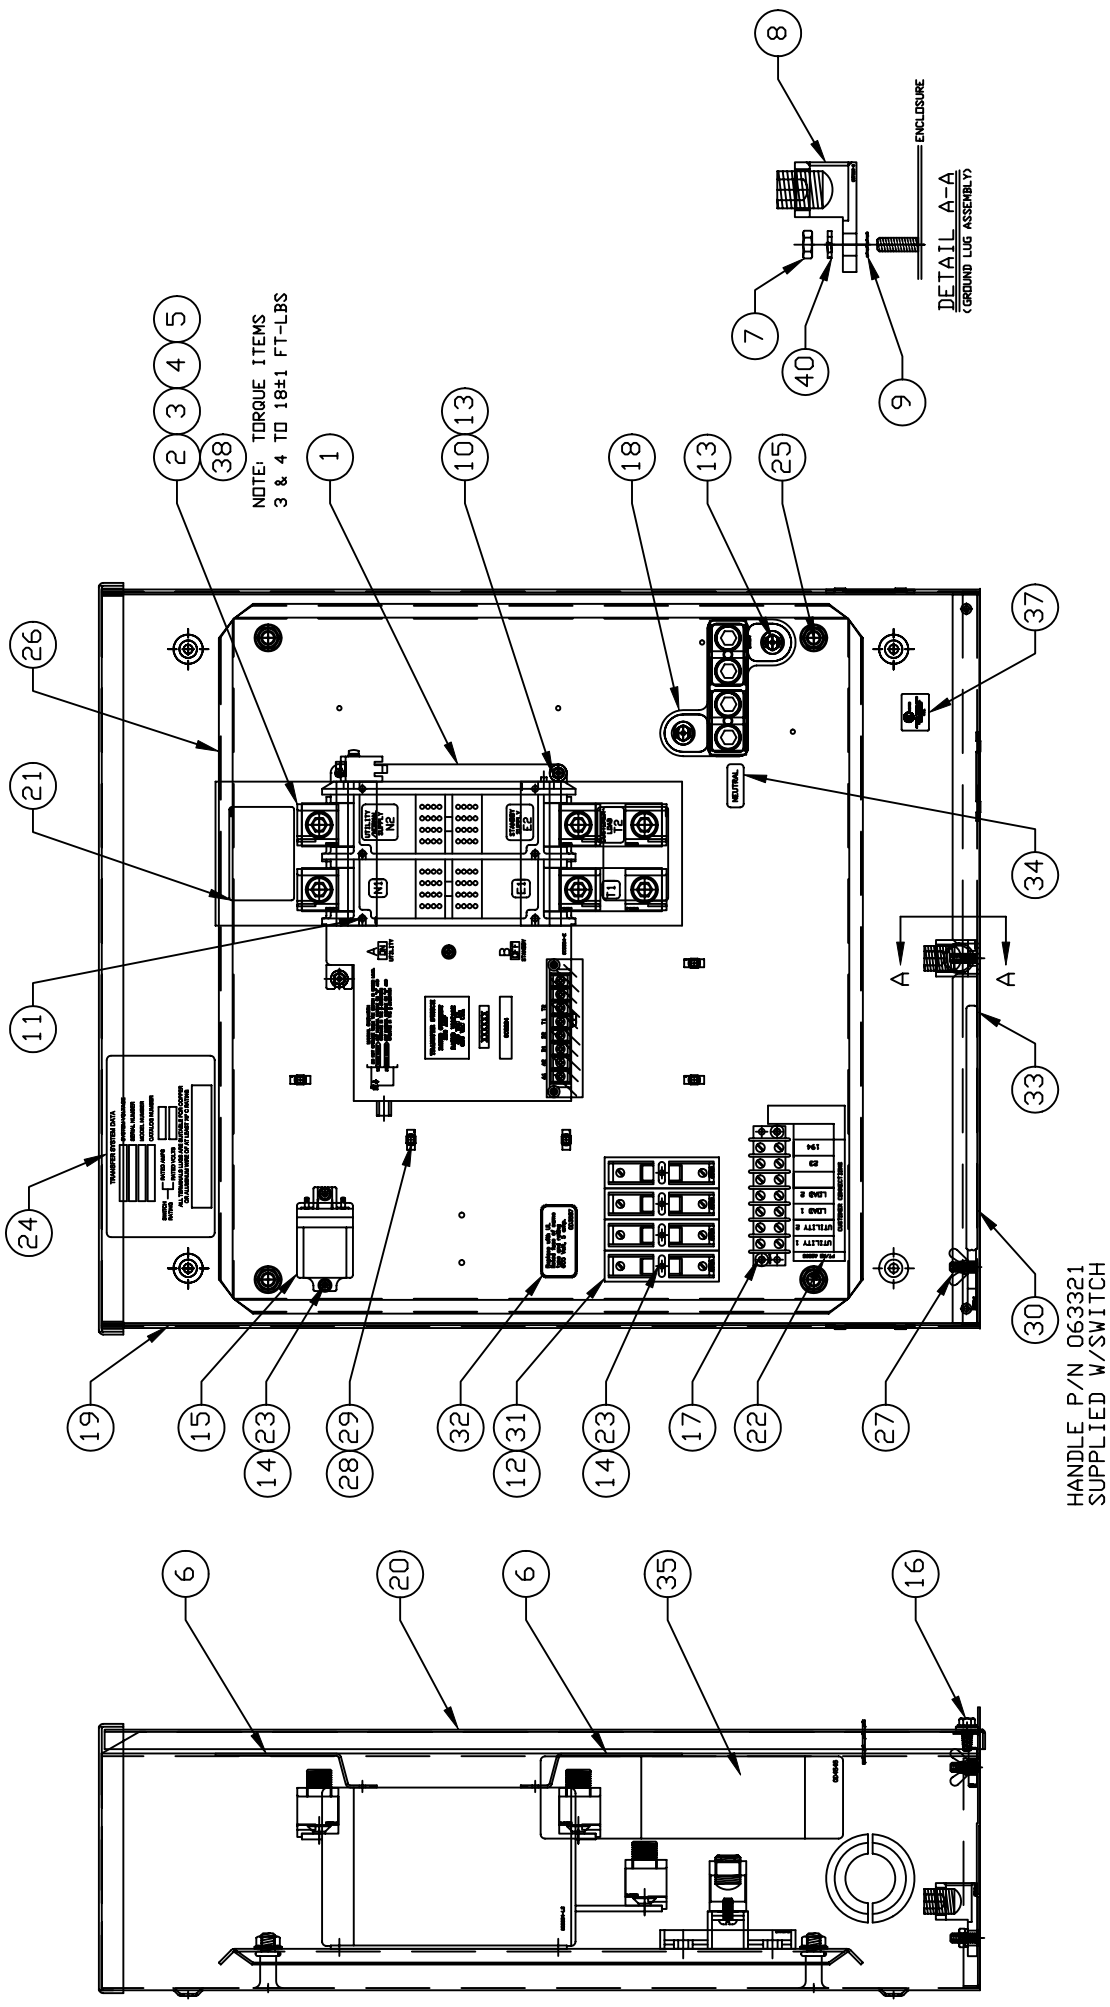

EXPLODED VIEW:
ASSY TRANSFER SW 200A 600V 2P 3R
DRAWING #: 0E2868A

EXPLODED VIEW: ASSY TRANSFER SW 200A 600V 2P 3R
 DRAWING #: 0E2868A


GROUP C

APPLICABLE TO:

ITEM	PART #	QTY.	DESCRIPTION
1	0C8884	1	XFER SW-W 200A600V2P
2	0A9949	6	LUG SLDLSS 400-#4X1/4-20 CU7AL
3	0C4896	6	SCREW FHM M8-1.25 X 20MM CR
4	067989	6	NUT LOCK FL M8-1.25 YEL CHR
5	026902	6	SCREW HHTT #8-32 X 1/4 CZ
6	0C7907H	2	COVER LUG 2P 150/200AMP
7	022127	1	NUT HEX 1/4-20 STEEL
8	057329	1	LUG SLDLSS 350-#6X13/32 AL/CU
9	027482	1	WASHER SHAKEPROOF EXT 5/16 STL
10	022097	3	WASHER LOCK M6-1/4
11	0C8275	4	SCREW PPHM DSEMS M4-7 X 10 ZNC
12	073591	4	FUSE HOLDER
13	090388	5	SCREW HHTT M6-1.0 X 12 ZINC
14	0A1495	6	SCREW HHTT M4-0.7 X 10 BP
15	063617	1	RELAY PNL 12VDC DPDT 10A@240VA
16	0C2454	2	SCREW TH-FRM M6-1X16 N WA Z/JS
17	0A1661	2	RIVET POP .156 X .675 AL
18	0C4449A	1	ASS'Y-NTRL BL150-200A
19	0E2865	1	WELDMENT,TRANSFER SWITCH BOX
20	0D3718	1	COVER, TRANSFER SWITCH BOX
21	0C8308	2	DECAL TERMINAL SHOCK HAZARD
22	0A2595	1	DECAL TERMINAL STRIP
23	022264	6	WASHER LOCK #8-M4
24	0G1519	1	DECAL DATA XFER SW
25	064101	4	NUT LOCK FL 3/8-16
26	0E2866	1	SUBPLT 200A TS 3R
27	025870	1	NUT WING 1/4-20
28	063378	5	HOLDER CABLE TIE
29	064761	5	TIE WRAP UL 5.6 X .10 NATL
30	063321	1	HANDLE XFER SWITCH 1-400A
31	073590A	4	FUSE 5A X BUSS
32	0D3587	1	DECAL, FUSE REPLACEMENT
33	067210A	1	DECAL GROUND LUG
34	0A9457	1	DECAL NEUTRAL
35	0D4545	1	DECAL, MANUAL OPERATION
36*	0E4307	1	DECAL,TEST SEQUENCE 2P TS 3R
37	081221	1	DECAL-UL LIST HSB
38**	0E4358	2	DECAL,LUG TORQUE INFO
39***	0E5567	1	DECAL,TRANSFER SWITCH
40	022129	1	WASHER LOCK M8-5/16

* CENTER DECAL ON INSIDE OF THE COVER (ITEM #20)
 ** INSTALL ACROSS E & N TERMINALS
 ***INSTALL ON FRONT OF THE COVER (ITEM #20)

GROUP C

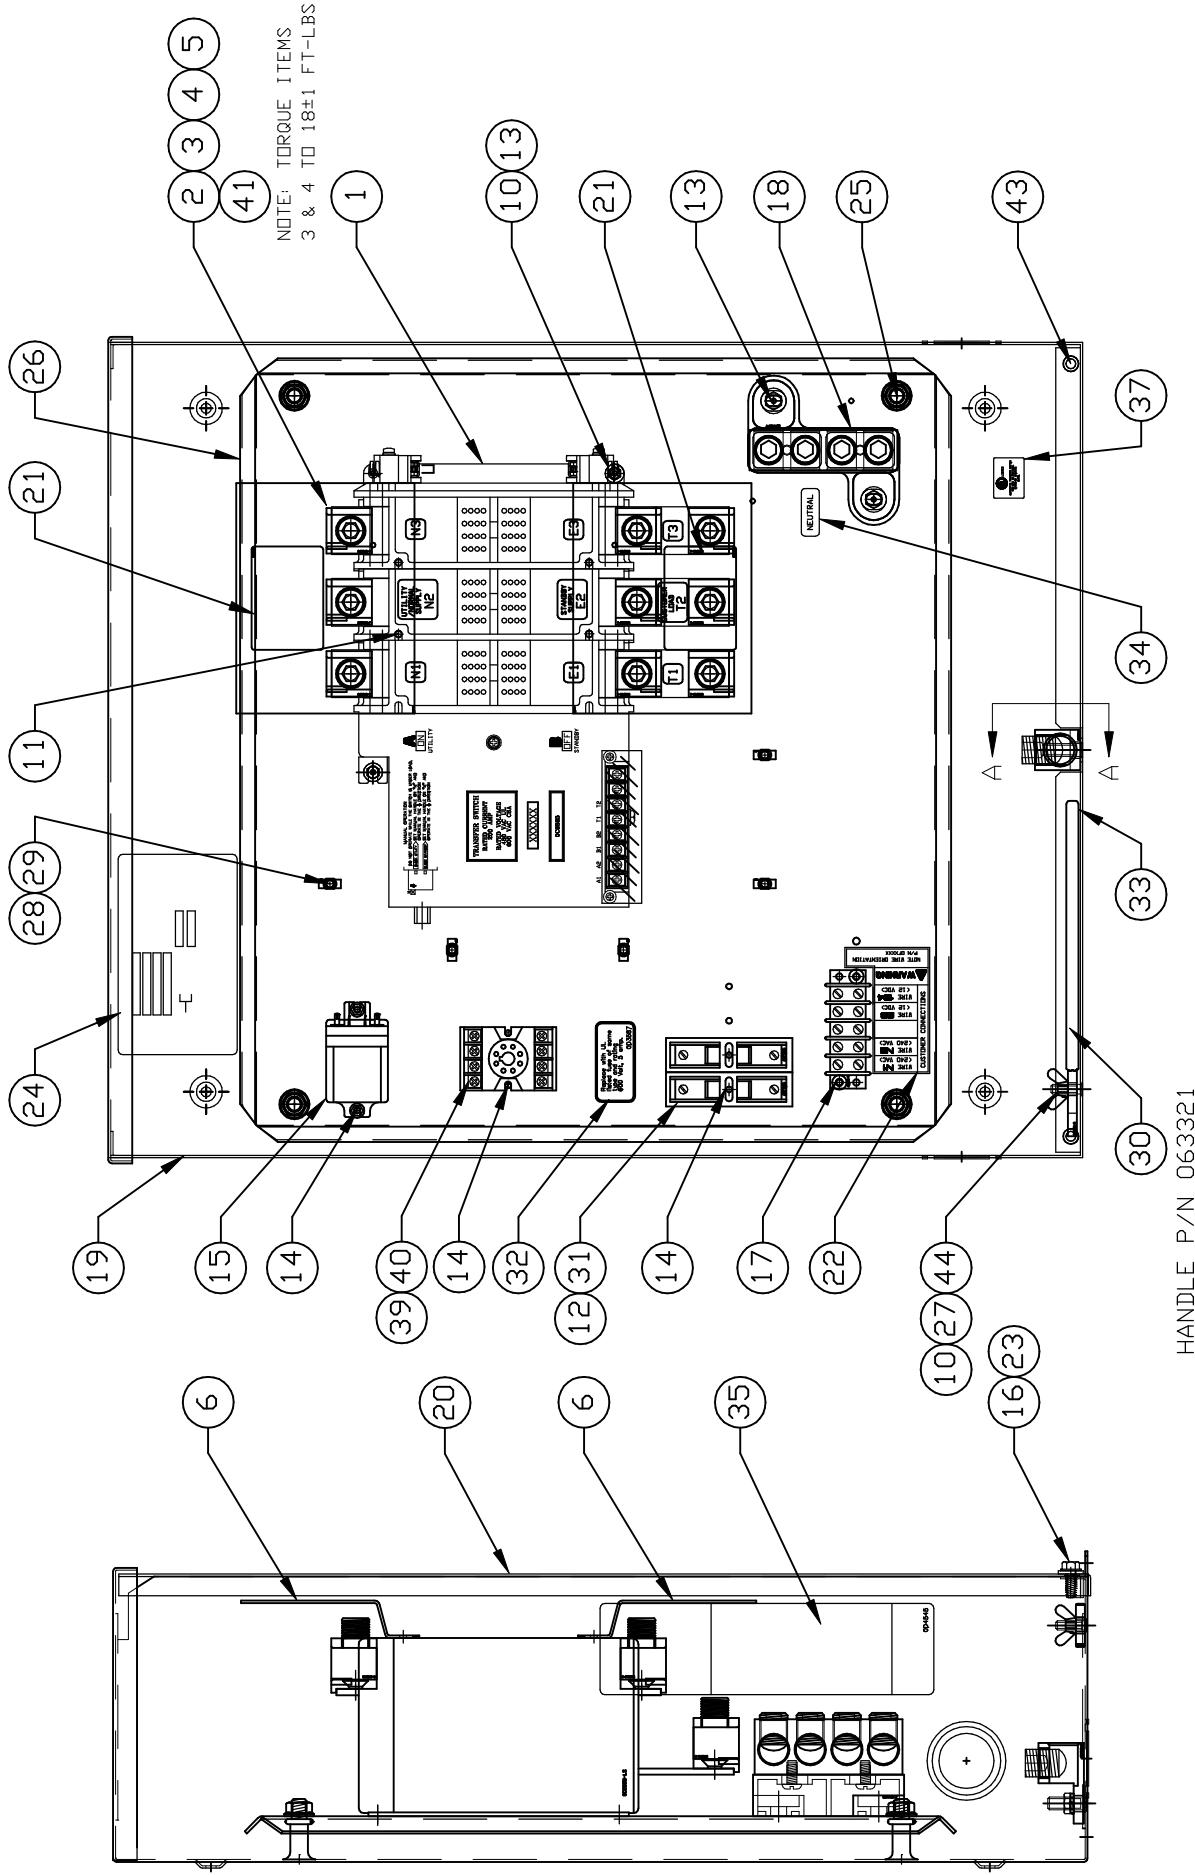

EXPLODED VIEW:
ASSY TRANSFER SW 200A 600V 3P 3R
DRAWING #: 0E4312A

APPLICABLE TO:

ITEM	PART #	QTY.	DESCRIPTION
1	0C8885	1	XFER SW-W 200A600V3P
2	0A9949	9	LUG SLDLSS 400-#4X1/4-20 CU7AL
3	0C4896	9	SCREW FHM M8-1.25 X 20MM CR
4	067989	9	NUT LOCK FL M8-1.25 YEL CHR
5	026902	7	SCREW HHTT #8-32 X 1/4 CZ
6	0C7907D	2	COVER LUG 3P 150/200AMP
7	045771	1	NUT HEX M8-1.25 G8 CLEAR ZINC
8	057329	1	LUG SLDLSS 350-#6X13/32 AL/CU
9	027482	1	WASHER SHAKEPROOF EXT 5/16 STL
10	022097	4	WASHER LOCK M6-1/4
11	0C8275	4	SCREW PPHM DSEMS M4-7 X 10 ZNC
(4) 12	073591	2	FUSE HOLDER
13	090388	5	SCREW HHTT M6-1.0 X 12 ZINC
14	0A1495	6	SCREW HHTT M4-0.7 X 10 BP
(4) 15	063617	1	RELAY PNL 12VDC DPDT 10A@240VA
16	085296	2	SCREW HHC 1/4-20 X 1/2 SS
17	0A1661	2	RIVET POP .156 X .675 AL
18	0C4449A	1	ASS'Y-NTRL BL150-200A
19	0E2865	1	WELDMNT, TRANSFER SWITCH BOX
20	0D3718	1	COVER, TRANSFER SWITCH BOX
21	0C8308	2	DECAL TERMINAL SHOCK HAZARD
22	0C2262	1	DECAL TERMINAL STRIP
23	0F6165	2	WASHER M6 NYLON
24	PER MODEL	1	DECAL DATA XFER SW
25	064101	4	NUT LOCK FL 3/8-16
26	0E2866	1	SUBPLT 200A TS 3R
27	087680	1	NUT WING M6-1.0
28	063378	5	HOLDER CABLE TIE
29	064761	5	TIE WRAP UL 5.6 X .10 NATL
30	063321	1	HANDLE XFER SWITCH 1-400A
31	073590A	2	FUSE 5A X BUSS
32	0D3587	1	DECAL, FUSE REPLACEMENT
33	067210A	1	DECAL GROUND LUG
34	0A9457	1	DECAL NEUTRAL
35	0D4545	1	DECAL, MANUAL OPERATION
(1) 36	0E4307	1	DECAL, TEST SEQUENCE 2P TS 3R
37	081221	1	DECAL-UL LIST HSB
38	022129	1	WASHER LOCK M8-5/16
39	063306	1	3-PHASE POWER MONITR
(4) 40	066972	1	SOCKET RELAY OCTAL 8P 300V-10A
(2) 41	0E4358	2	DECAL, LUG TORQUE INFO
(3) 42	PER MODEL	1	DECAL TRANSFER SWITCH RTS
43	058000E	2	NUT TRIC 1/4-20 X .525
44	022473	1	WASHER FLAT 1/4-M6 ZINC

- (1) CENTER DECAL ON INSIDE OF THE COVER (ITEM #20)
- (2) INSTALL ACROSS E & N TERMINALS
- (3) INSTALL ON FRONT OF THE COVER (ITEM #20)
- (4) STRUCTURED IN HARNESS (P/N 0F6796)